





Second Pier North of Abutment No. 1


Material: Concrete Wall Pier  
Cracks: None noted  
Impact Damage: None noted  
Channel Bottom Material: Silt  
Scour: None noted  
Exposed Footing: None noted  
Exposed Foundation Piling: None noted  
Condition of Pier (Mud-line to Water-line): Fair  
Notes: Flow = 3.7 ft/sec; Deep scaling, spalls, and pop-outs noted (see drawing)

 2014 Water Level Random Area of Patching


PLAN  
Not to Scale

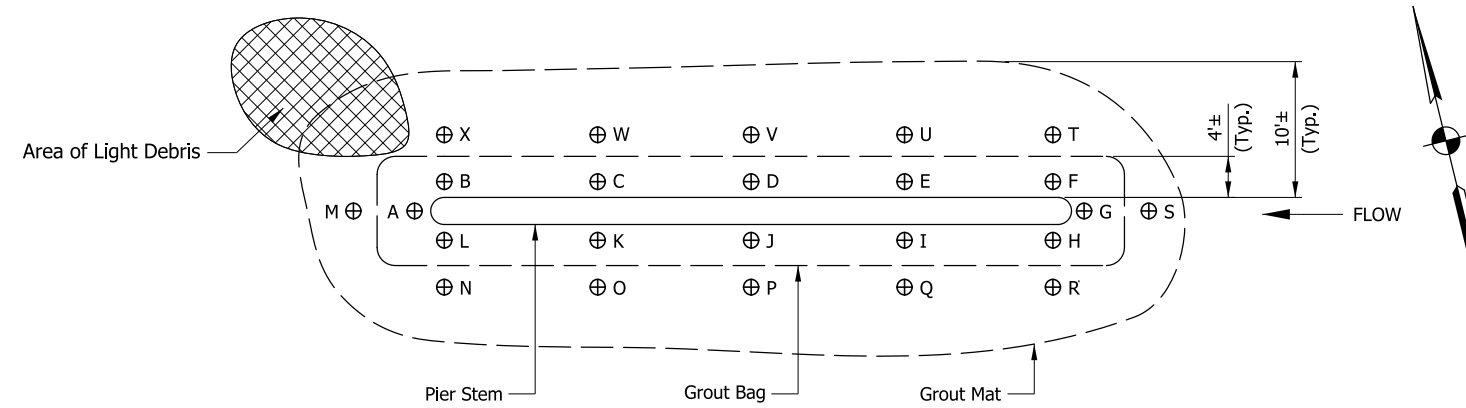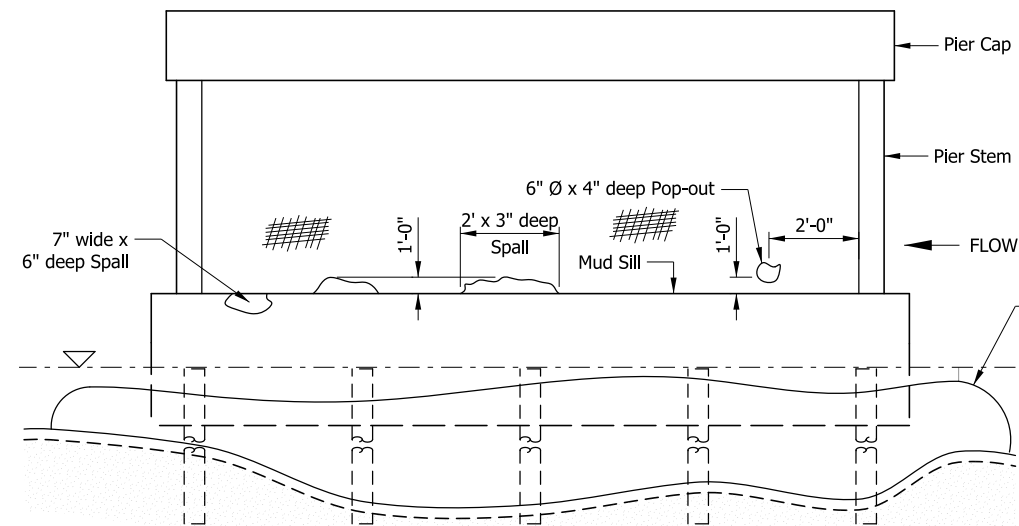[illegible]

SOUTH ELEVATION  
Not to Scale

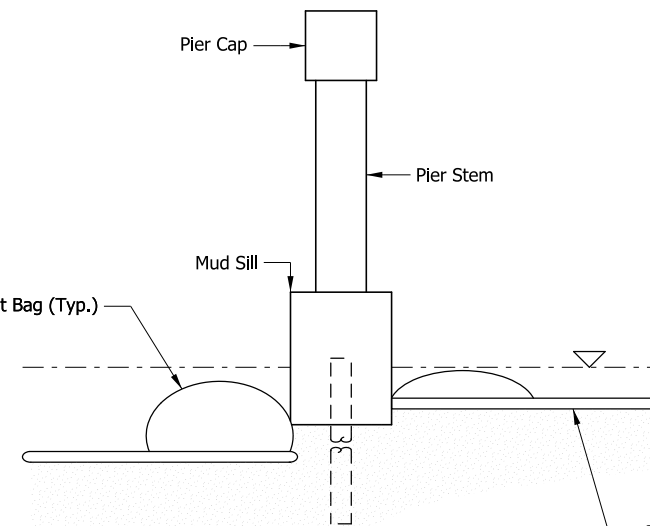

UPSTREAM ELEVATION  
Not to Scale

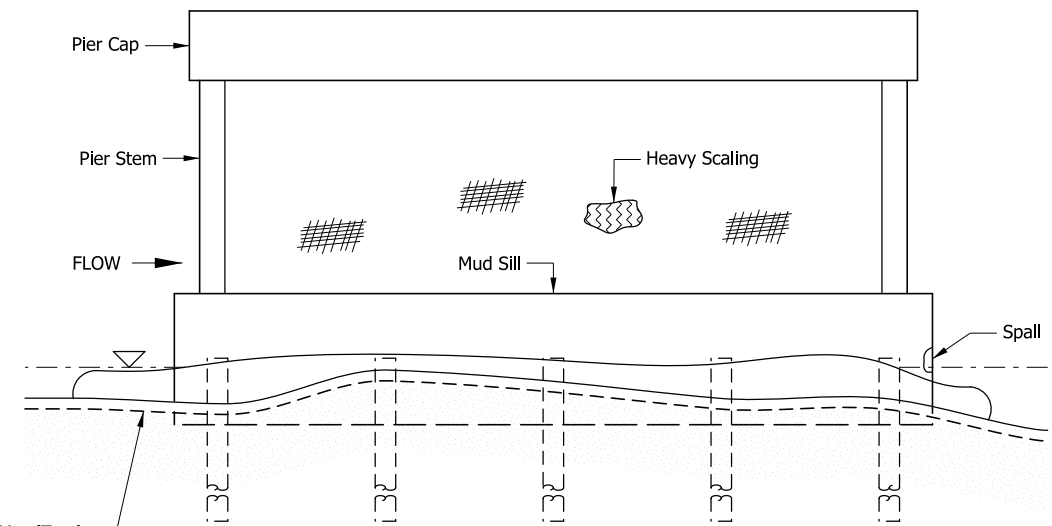

NORTH ELEVATION  
Not to Scale