
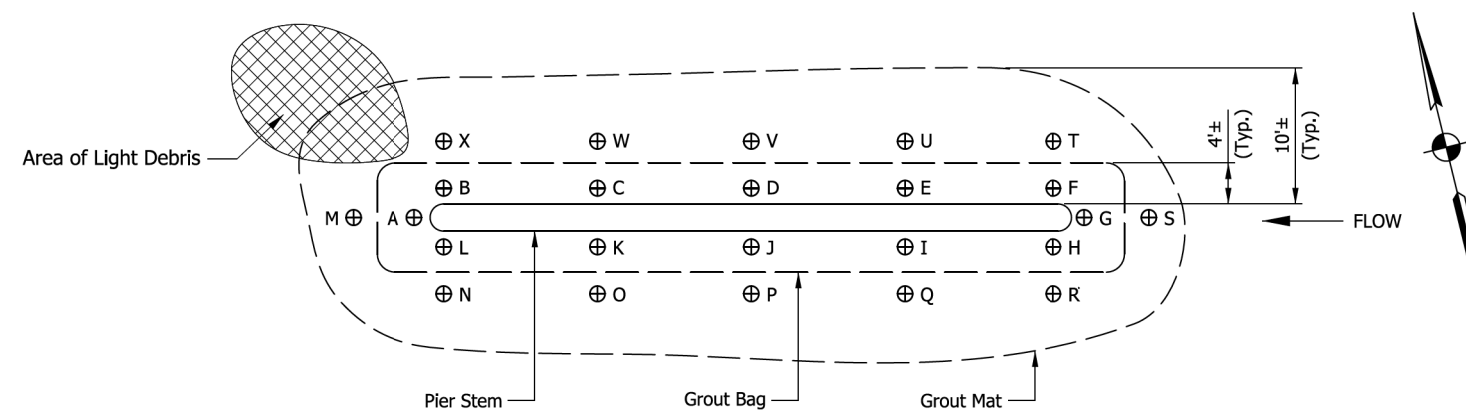


Second Pier North of Abutment No. 1


Material: Concrete Wall Pier
Cracks: None noted
Impact Damage: None noted
Channel Bottom Material: Silt
Scour: None noted
Exposed Footing: None noted
Exposed Foundation Piling: None noted
Condition of Pier (Mud-line to Water-line): Fair
Notes: Flow = 3.7 ft/sec; Deep scaling, spalls, and pop-outs noted (see drawing)




2014 Water Level

 Random Area of Patching


PLAN
Not to Scale

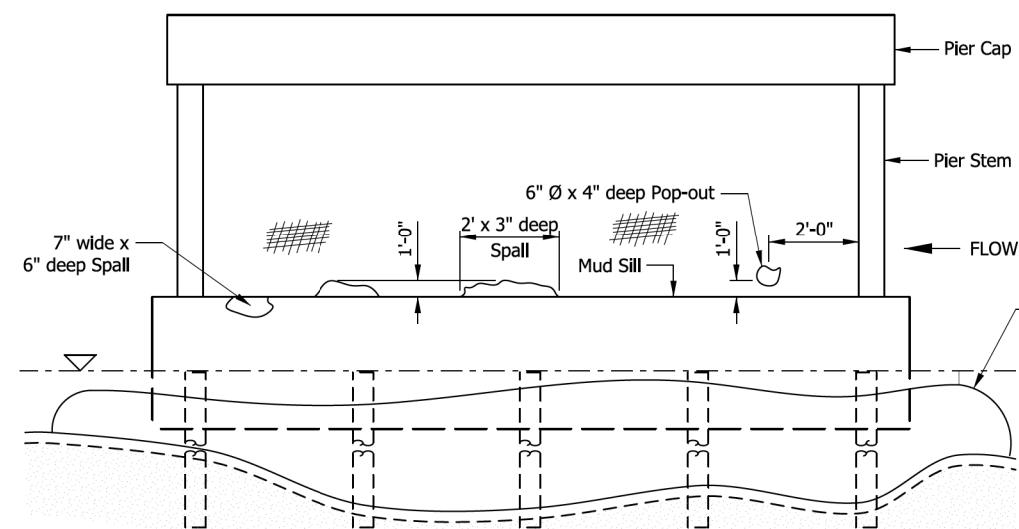[illegible]

SOUTH ELEVATION
Not to Scale

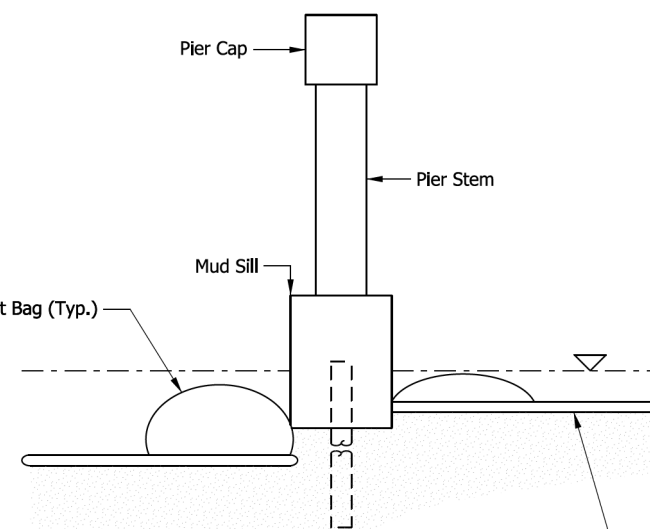

UPSTREAM ELEVATION
Not to Scale

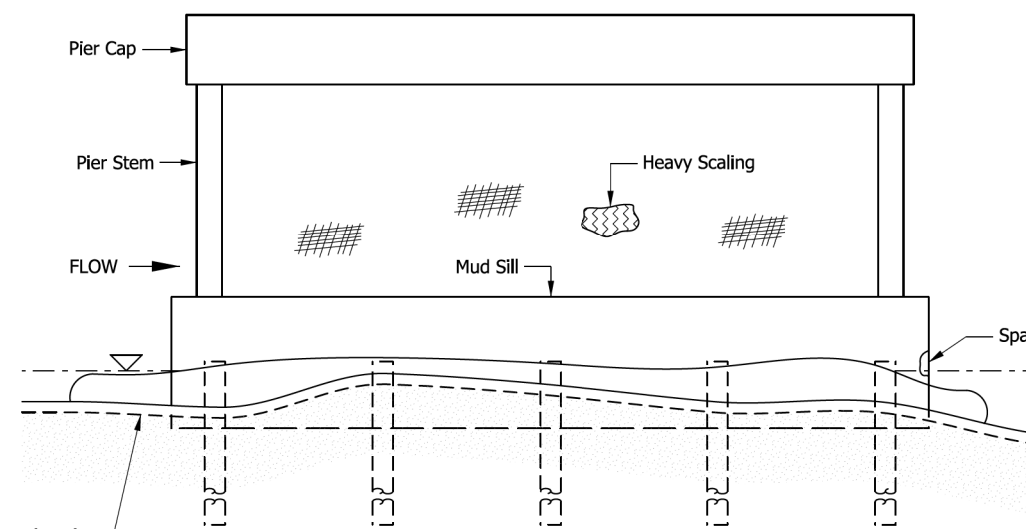

NORTH ELEVATION
Not to Scale