


## ISO 出图异径斜三通材料单中的 size 没有显示 branch 的 size

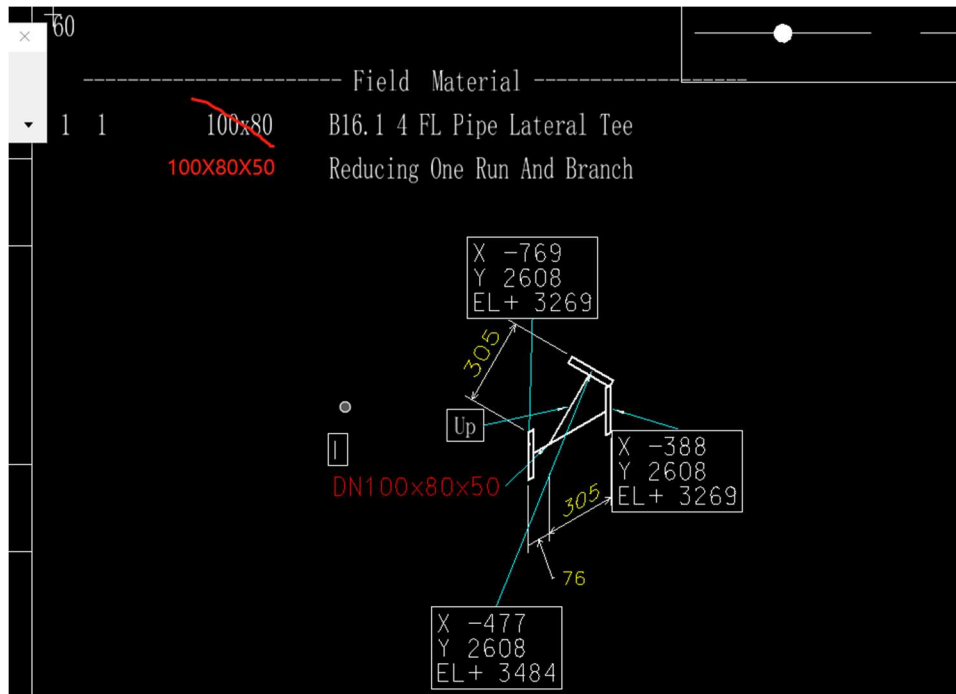

修改步骤:

第一步: 在 report.def 中添加 COLUMN=7:R:SIZE3:

```

122
123
124 # -----
125 # A sample report that writes field material to a report
126 # Definition is the same as for the SHP report except for the INCLUDE line
127 # -----
128 REPORT = FLD
129
130 # this to include only field items
131 INCLUDE = IE_FIELD=1
132 EXCLUDE = IE_TYPE=CT_WELD
133
134 COLUMN = 3: R : PARTID
135 COLUMN = 19: R : QUANTITY
136 COLUMN = 7: R : SIZE1
137 COLUMN = 7: R : SIZE2
138 COLUMN = 7: R : SIZE3
139 COLUMN = 2: :
140 COLUMN = 60: W : IE_DESCRIPT
141
142 GROUP = PARTID
143 SORT = PARTID:N
144 SEP = @
145 SORTEHEADERS = 1
146
147 TEXT = @ -----
148 TEXT = @ Field Materials
149 TEXT = @ -----
150 Write =
151 END
152

```

第二步：打开对应种子文件，在表格中增加一列 size3：

Bill of Materials				
Pos	Quantity	Size1	Size2	Size3
Description				

第三步：Generate ISO 查看生成的 BOM 如下：

Bill of Materials				
Pos	Quantity	Size1	Size2	Size3
Description				
-----				
Shop Materials				
-----				
Pipes				
-----				
1	214	50		B36 10 2 PE Pipe
-----				
Fittings				
-----				
2	1	80	50	B16 9 3 BW Concentric Pipe Reducer
3	1	80		B16 5 3 FL Weld Neck Flange
-----				
Field Materials				
-----				
Fittings				
-----				
4	1	100	80	50 B16 1 4 FL Pipe Lateral Tee Reducing One Run And Branch
-----				
Gaskets				
-----				
5	1	80		B16 21 3 Gasket
-----				
Bolts				
-----				
6		Ø 5/8"	3"	AMERICAN DUCTILE IRON Ø - 5/8 X 3 STUD BOLTS